IMPORTANT INSTALLATION NOTES:


- FIXTURE TO BE INSTALLED IN ACCORDANCE WITH ALL APPLICABLE CODES BY A QUALIFIED ELECTRICIAN OR OTHER PERSON FAMILIAR WITH THE CONSTRUCTION AND OPERATION OF THIS PRODUCT AND THE HAZARDS INVOLVED.
- INSURE ALL HANGING POINTS ARE IN LINE WITH THE CENTERLINE OF THE FIXTURE RUN. IF THEY ARE NOT PROPERLY ALIGNED, THE RUN WILL NOT HANG STRIAGHT
- HANG INDIVIDUAL OR START FIXTURE SECTIONS FIRST. THESE WILL HAVE (2) CABLE SUPPORTS AND BE SELF SUPPORTING. TAKE CARE TO LEVEL THE FIXTURE AT THIS POINT, ESPECIALLY FOR CONTINUOUS RUNS.
- FOR CONTINUOUS RUNS, HANG EACH SUCCESSIVE SECTION USING (1) ADDITIONAL CABLE SUPPORT AND THE JOINING AND ALIGNING HARDWARE PROVIDED WITH THE FIXTURES, AND LEVEL EACH SECTION WITH THE PREVIOUS ONE.

 ***PO NOT ATTEMPT TO BOLT FIXTURES TOGETHER AND RAISE THE ASSEMBLED RUN AT ONE TIME. THIS WILL DAMAGE THE INTERNAL


 BRACKETRY AND PREVENT THE FIXTURES FROM JOINING TIGHTLY, AND WILL VOID THE FIXTURE WARRANTY!***


 FOLLOW THE SAME PROCEDURE ABOVE TO INSTALL THE END UNIT.

- RECHECK ALL FIXTURES FOR LEVEL AND INSURE ALL JOINTS ARE TIGHT.
- IF SMALL GAPS OCCUR BETWEEN FIXTURE SECTIONS, APPLY A SMALL AMOUNT OF CAULK BETWEEN SECTIONS AND WIPE OFF EXCESS WITH A DAMP CLOTH.

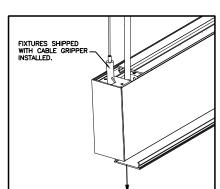


 -LOCATE ELECTRICAL FEED POINT AND MOUNTING LOCATIONS FOR HANGING CABLES PER CUSTOMER -REFERENCE CUSTOMER DRAWING AND CANOPY -DROP CABLES DOWN FOR HANGING FIXTURES. -REMOVE LOWER LENS FROM EACH 'STARTER', 'MIDDLE' AND 'END' FIXTURE. -MARK EACH LENS TO CORRESPONDING FIXTURE AND PUT ASIDE TO BE REINSTALLED IN STEP 7.




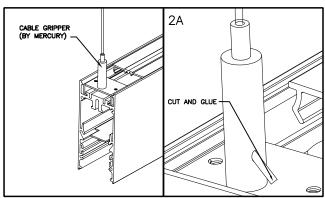

-ADJUST CABLE UNTIL FIXTURE IS AT CUSTOMER'S FOR 'MIDDLE' AND 'END' MODULES, CONTINUE TO

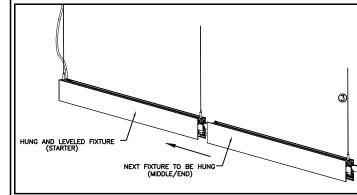

-INSERT HANGING CABLE INTO CABLE GRIPPER (1) ON NEXT FIXTURE (MIDDLE OR END). SEE DETAIL 3

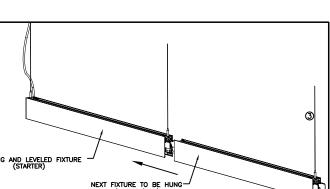

STEP 4;
-ALIGN FIXTURE USING ALIGNERS BY MERCURY
-CONNECT POWER CONNECTOR BETWEEN FIXTURES.

MLS2 DIRECT-INDIRECT

Date:

Distributor:


Dwg. no.:


INSTALLATION INSTRUCTION

Scale:


Rev.

Size:

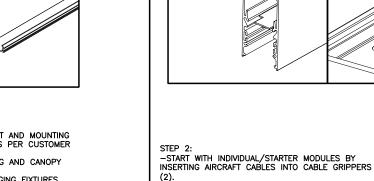

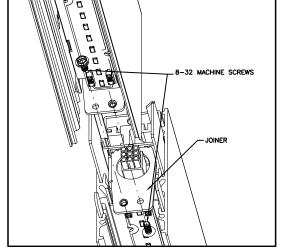


STEP 5
-PUSH EXCESS POWER CONNECTOR CABLES
BACK INTO FIXTURE THROUGH JOINERS AS
SHOWN FOR MLS-2 OR TO EITHER SIDE OF JOINER FOR MLS-3 -SECURE FIXTURES TOGETHER USING (2) 8-32 SCREWS THROUGH JOINER AS SHOWN ABOVE (PROVIDED BY MERCURY). -REPEAT STEP 4 & 5 AS NEEDED UNTIL 'END' MODULE IS INSTALLED. -CHECK THAT RUN IS STRAIGHT AND LEVEL AND ADJUST AS NECESSARY. ALL JOINTS SHOULD BE TIGHT TOP TO BOTTOM ON BOTH SIDES OF THE FIXTURE RUN.

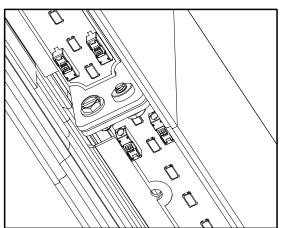


COMPLETE JOINT ASSEMBLY -ONCE FINAL LEVELING IS COMPLETED, CUT OFF

EXCESS CABLE AND LEAVE 1/2" COMING OUT FROM CABLE GRIPPER AS SHOWN (SEE DETAIL 2A ABOVE)
-AIRCRAFT CABLE MANUFACTURER RECOMMENDS A DAB OF CRAZY GLUE ON CUT CABLE TO AVOID UNRAVELLING.(SEE DETAIL 2A ABOVE)

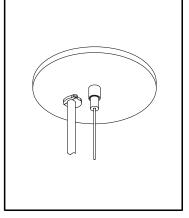


-MAKE ELECTRICAL CONNECTION TO BUILDING AT CEILING AND RAISE AND SECURE CANOPY.

*CAUTION- BUILDING POWER SHOULD BE OFF WHEN CONNECTION IS MADE TO FIXTURE.

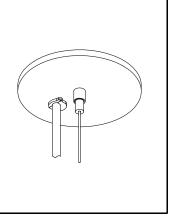

-REINSTALL LENSES IN SAME FIXTURES AS THEY WERE REMOVED FROM IN STEP 1.

-ENERGIZE FIXTURES.

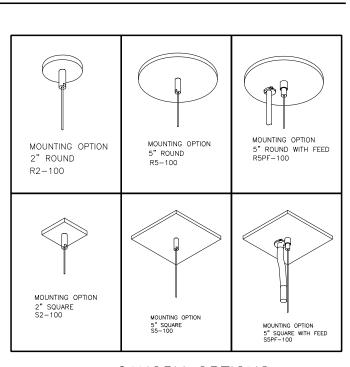

MERCURY

Lighting Progress

20 Audrey Place Fairfield, NJ 07004 U.S.A.

MLS2G3DI-400/400-935K-HTA-BW-U

(9)

LOWER TABS ALIGNER

CATALOG NO:

CANOPY OPTIONS

🥨 MERCURY